 <b>HYUNDAI</b>   NEW THINKING. NEW POSSIBILITIES. <b>Technical Service Bulletin</b>	<b>GROUP</b> <b>ELECTRICAL</b>	<b>NUMBER</b> <b>11-BE-015</b>
	<b>DATE</b> <b>DECEMBER, 2011</b>	<b>MODEL(S)</b> <b>ELANTRA (MD/UD), TUCSON (LM), GENESIS COUPE (BK), SONATA (YF), GENESIS (BH), SANTA FE (CM)</b>
<b>SUBJECT: NAVIGATION TOUCH SCREEN RECALIBRATION</b>		

**Description:** This bulletin describes the procedure to recalibrate the navigation touch screen.



**Applicable Vehicles:** Elantra (MD/UD), Tucson (LM), Genesis Coupe (BK), Sonata (YF), Genesis (BH). Santa Fe (CM) with touch screen navigation only.

**Warranty Information:**

**NO APPLICABLE WARRANTY**

Circulate To: General Manager, Service Manager, Parts Manager, Warranty Manager, Service Advisors, Technicians, Body Shop Manager, Fleet Repair

**Service Procedure:**


1. Press "Agree".

**\* NOTE**

All pictures are from an Elantra (UD/MD)



2. Press the following sequence:
  - a) MAP VOICE x2 (press twice)
  - b) DEST x2 (press twice)
  - c) ROUTE x2 (press twice)
  - d) MAP VOICE x1 (press once)
  - e) DEST x2 (press twice)
  - f) ROUTE x2 (press twice)
  - g) Repeat steps "d-f" above until you see "+" on the screen

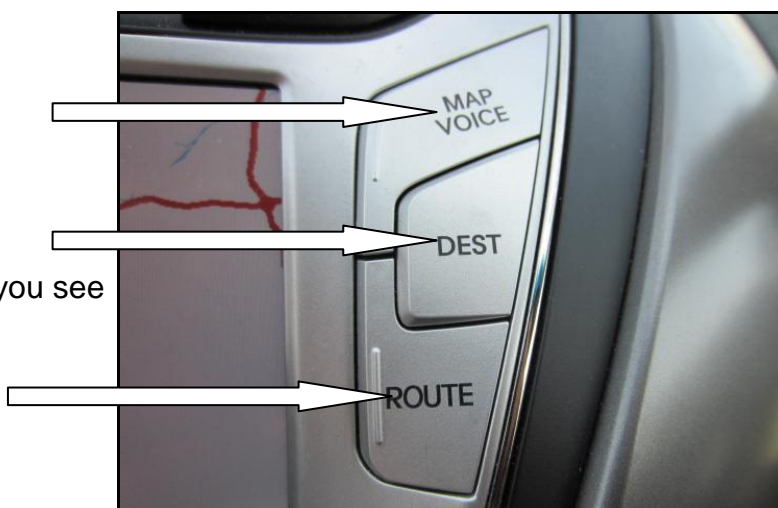


3. If successful, the screen shown to the right will appear.



4. Press and hold “+” until it moves.  
Repeat until “+” disappears.



5. After “+” disappears press the screen once to save setting within 30 seconds.

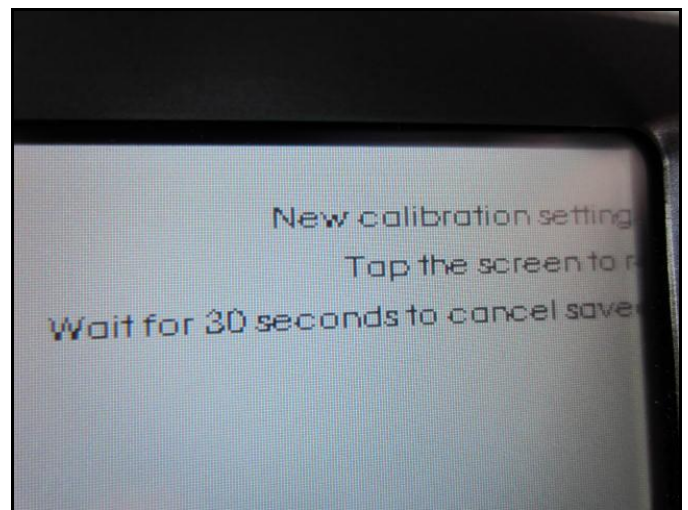**WARNING**

Press screen within 30 seconds  
to save settings.

6. Screen may momentarily be blank.  
Wait until the map is fully loaded.



- 7. Check all touch screen functions.

